

Instruction and operation manual

S 230/231

Dew point sensor



Dew Point sensor with optional hazardous approval for applications in demanding industrial applications and hazardous environments

Dear Customer,

Thank you for choosing our product.

The operating instructions must be read in full and carefully observed before starting up the device. The manufacturer cannot be held liable for any damage which occurs as a result of non-observance or non-compliance with this manual.

Should the device be tampered with in any manner other than a procedure which is described and specified in the manual, the warranty is cancelled and the manufacturer is exempt from liability.


The device is destined exclusively for the described application.

SUTO offers no guarantee for the suitability for any other purpose. SUTO is also not liable for consequential damage resulting from the delivery, capability or use of this device.

Table of contents

1. Safety instructions	4
2. Application	8
3. Features	8
4. Technical Data	9
4.1 General	9
4.2 Electrical Data	9
4.3 Output-Signals	9
4.4 Accuracy	10
5. Dimensional drawing	11
6. Installationen	12
6.1 General installation considerations	12
6.2 Fluid/ambient temperature	12
6.3 Cable entries	12
6.4 Potential equalization	13
6.5 Service kit	13
6.6 Fuse	13
6.7 Back cover / security seal	13
6.8 Used standards	14
6.9 Determination of the installation point	14
6.10 Installation Requirements	15
6.11 Sensor installation to compressed air / gas	15
6.12 Electrical connection	17
7. Signal outputs	17
7.1 Analogue output	17
7.2 Modbus output	17
8. Optional extra accessories	19
8.1 Measuring chambers	19
8.2 Service kit	19
9. Calibration	20
10. Maintenance	20
11. Disposal or waste	20
12. Warranty	20

1. Safety instructions

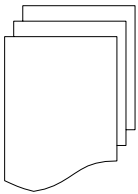

Please check if this instruction manual accords to the product type.

Please observe all notes and instructions indicated in this manual. It contains essential information which have to be observed before and during installation, operation and maintenance. Therefore this instruction manual has to be read carefully by the technician as well as by the responsible user / qualified personnel.

This instruction manual has to be available at the operation site of the dew point sensor at any time. In case of any obscurities or questions, regarding this manual or the product, please contact the manufacturer.



This document contains important information for the installation and operation of the dew point sensor in explosive environments. Please read the instructions carefully and follow the instructions mentioned in this manual.

- Do not exceed the maximum permitted pressure range (see sensors label).
- The installation and the supply connection must be done in compliance with national regulations for devices used in potentially explosive atmospheres.
- The compliance with all of the technical data of the device is mandatory (see also nameplate).
- Only qualified specialists who are trained in Ex-related issues are allowed to install, connect the electricity and maintain the device
- The device should be opened in a non-explosive atmosphere or in a de-energized state where a delay of 5 minutes after power down has to be ensured.
- No connection of service-kit or any other devices are permitted if the atmosphere is considered to be explosive.
- When opening the enclosure make sure that no dust or moisture enters into the casing.
- Ensure that cable entries are tightly sealed
- Materials which come in contact with the medium are of stainless steel 1.4404 / 316L and of sealing rubber NBR.

**Special Attention!**

The device must be connected to the potential equalization system. Please refer to page 5 regarding "Potential equalization"

**WARNING!****Compressed air!**

Any contact with quickly escaping air or bursting parts of the compressed air system can lead to serious injuries or even death!

- Do not use S 230/231 in hazardous environment without the optional hazardous approval rating (order code: A1480 or A1481, or A1482)!
- Do not exceed the maximum permitted pressure range (see sensors label).
- Only use pressure tight installation material.
- Avoid that persons get hit escaping air or bursting parts of the instrument.
- The system must not be pressurized during maintenance work.
- Consider all regulations for electrical installations.
- The system must be disconnected from any power supply during maintenance work.
- Any electrical work on the system is only allowed by authorized qualified personal.

**WARNING!****Permitted operating parameters!**

Observe the permitted operating parameters, any operation exceeding this parameters can lead to malfunctions and may lead to damage on the instrument or the system.

- Do not exceed the permitted operating parameters.
- Make sure the product is operated in its permitted limitations.
- Do not exceed or undercut the permitted storage and operation temperature and pressure.
- The product should be maintained and calibrated frequently, at least annually.

General safety instructions

- It is not allowed to use the product in explosive areas.
- Please observe the national regulations before/during installation and operation.

Remarks

- It is not allowed to disassemble the product.
- Always use spanner to mount the product properly.



ATTENTION!

Measurement values can be affected by malfunction!

The product must be installed properly and frequently maintained, otherwise it may lead to wrong measurement values, which can lead to wrong results.

Storage and transportation

- Make sure that transportation temperature of the sensor is between -30°C ... 70°C .
- For storage and transportation it is recommended to use the packaging which comes with the sensor.
- Please make sure that the storage temperature of the sensor is between 0°C ... 50°C .
- Avoid direct UV and solar radiation during storage.
- For the storage the humidity has to be $<90\%$, no condensation.

Examination certificates, certificate of conformity

The system meets the fundamental health and safety requirements for the design and construction of devices and protective systems intended for use in potentially explosive atmospheres in accordance with appendix II of directive 94/9/EC.

Name plate

Below are the name plates when ordered with hazardous approval.

ATEX:

○	S 230 Ex Item number : S699 0230 Serial number : 2717 0001 Supply : 10 ... 30 VDC, 1 W Tmed : -30 ... +70 °C (T4) Tamb : 0 ... +50 °C Max. pressure : 1.6 MPa Range TD : -100 ... +20 °C	SUTO ITEC (China) Co., Ltd. No. 1001 Zhongshanyuan Rd., Nanshan, Shenzhen, PRC		 www.suto-itec.com	○
		Ex db[ib] IIC T4 Gb PTZ 17 ATEX 0009 X  	Caution! - Please read instruction manual before working on device. - The device should be opened in a non-explosive atmosphere or in a de-energized state where a delay of 5 minutes after power down has to be ensured.		

○	S 231 Ex Item number : S699 0231 Serial number : 2717 0001 Supply : 10 ... 30 VDC, 1 W Tmed : -30 ... +70 °C (T4) Tamb : 0 ... +50 °C Max. pressure : 35 MPa Range TD : -50 ... +20 °C	SUTO ITEC (China) Co., Ltd. No. 1001 Zhongshanyuan Rd., Nanshan, Shenzhen, PRC		 www.suto-itec.com	○
		Ex db[ib] IIC T4 Gb PTZ 17 ATEX 0009 X  	Caution! - Please read instruction manual before working on device. - The device should be opened in a non-explosive atmosphere or in a de-energized state where a delay of 5 minutes after power down has to be ensured.		

IECEX:

○	S 230 Ex Item number : S699 0230 Serial number : 2717 0001 Supply : 10 ... 30 VDC, 1 W Tmed : -30 ... +70 °C (T4) Tamb : 0 ... +50 °C Max. pressure : 1.6 MPa Range TD : -100 ... +20 °C	SUTO ITEC (China) Co., Ltd. No. 1001 Zhongshanyuan Rd., Nanshan, Shenzhen, PRC		 www.suto-itec.com	○
		Ex db[ib] IIC T4 Gb IECEX PTZ 17.0004 X 	Caution! - Please read instruction manual before working on device. - The device should be opened in a non-explosive atmosphere or in a de-energized state where a delay of 5 minutes after power down has to be ensured.		

○	S 231 Ex Item number : S699 0231 Serial number : 2717 0001 Supply : 10 ... 30 VDC, 1 W Tmed : -30 ... +70 °C (T4) Tamb : 0 ... +50 °C Max. pressure : 35 MPa Range TD : -50 ... +20 °C	SUTO ITEC (China) Co., Ltd. No. 1001 Zhongshanyuan Rd., Nanshan, Shenzhen, PRC		 www.suto-itec.com	○
		Ex db[ib] IIC T4 Gb IECEX PTZ 17.0004 X 	Caution! - Please read instruction manual before working on device. - The device should be opened in a non-explosive atmosphere or in a de-energized state where a delay of 5 minutes after power down has to be ensured.		

2. Application

The S 230/231 is a dew point sensor which is designed to monitor the dew point in hazardous environments and industrial application within the permissible operating parameters.

The S 230/231 measures the following values:

- Dew point of the compressed air or gas.
- Temperature of the compressed air or gas.
- Other selectable moisture units such as: relative humidity [%], absolute humidity [g/m^3 , mg/m^3], humidity grade [g/kg], humidity ratio by volume [ppmv] of the compressed air or gas.

The default factory settings are: temperature in °C and dew point in °Ctd. Other units can be programmed by the service kit.

3. Features

- Dew point sensor for hazardous environment (ATEX, IECEx approval)
- Double sensor technology for best accuracy over the whole range from -100°C ... $+20^{\circ}\text{C}$ dew point in S 230.
- Robust industrial design
- Outputs: 1 x 4 ... 20 mA, RS-485 (Modbus).
- IP67 casing provides robust protection in rough industrial environment.
- Very fast response time ensures safe and reliable indication whenever dew points are out of valid ranges.
- High accuracy

4. Technical Data

4.1 General

CE	
Parameters	Dew point: °C or °F Temperature: °C or °F other moisture units: - relative humidity [%] - absolute humidity [g/m ³ , mg/m ³] - humidity grade [g/kg] - humidity ratio by volume [ppmv]
Sensor	S 230: Quartz crystal and polymer sensor S 231: Polymer sensor
Measuring medium	Non-corrosive gases
Measuring range	Dew point: -100°Ctd ... +20°Ctd (S 230) -50°Ctd ... +20°Ctd (S 231) Temperature: -30°C ... 70°C
Response time T ₉₀	< 240 sec (-20 → -60 °C) < 30 sec (-60 → -20 °C)
Ambient temperature	0°C ... 50°C
Transport temperature	-30°C ... 70°C
Casing material	Process connection: stainless steel Casing: aluminium alloy
Protection class	IP67
Dimensions	See dimensional drawing on the next page
Screwing thread	G ½" thread (ISO 228/1)
Weight	0.4 kg

4.2 Electrical Data

Power supply	12 ... 30 VDC / 30 mA
--------------	-----------------------

4.3 Output-Signals

Analogue output	4 ... 20 mA, isolated
-----------------	-----------------------


Analogue output scaling (default: dew point)	S 230: 4 mA = -100 °Ctd 20 mA = +20 °Ctd S 231: 4 mA = -50 °Ctd 20 mA = +20 °Ctd
RS-485	Modbus/RTU

4.4 Accuracy

Accuracy	Dew point: see chart below Temperature: 0.3 °C
Repeatability	± 1.0 °C
Stated accuracy at	Ambient/process temperature 23°C ± 3°C Process temperature 23°C ± 3°C Ambient/process humidity <95%, no condensation Airflow > 1 l/min at sensor tip



5. Dimensional drawing

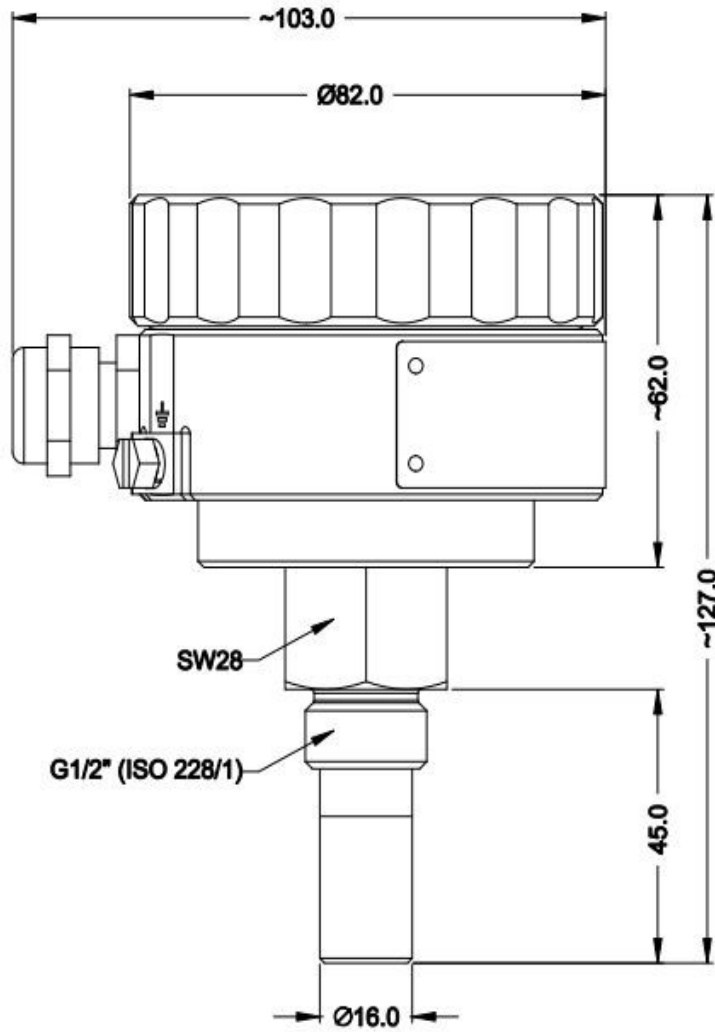

6. Installationen

6.1 General installation considerations

- To all terminals of the dew point transmitter S 230/231, only devices with rating $U_m \leq 24 \text{ V DC}$ and $I_m \leq 500 \text{ mA}$ are allowed to be connected.
- The dew point sensor is only allowed to be used in the permitted temperature class.
- For ambient temperatures below -20 °C cables, drain plugs, cable glands and cable entries must be suitable and certified.
- Cables and pipe entries must be certified (Ex d IIC) and must be suitable for operating temperatures of up to 105 °C . When using pipe entries, the associated sealing equipment must be fitted directly at the housing.

6.2 Fluid/ambient temperature

ATTENTION: The minimum temperature for fluid and ambient is -30 °C .

6.3 Cable entries

The cable glands/entries must be secured to prevent working loose and the seals have to be installed immediately adjacent to the casing.

Please ensure that the cable entries and cable glands are leak-tight!

The cables used must be manufactured in a way that the build-up of electrostatic charges are avoided!

Only following cable gland is allowed to be used and can be ordered at SUTO:

	Hummel Order No.	Description	Thread size	Cable entry
Gland	1.622.1600.50	HSK-M-Ex-d/Metr	M16 x 1.5	5 ... 10 mm

Cable outer diameter must be between 5.0 ... 10 mm!

6.4 Potential equalization

For the safety of the operation in explosive environment the potential equalization is very important. The device has a screw terminal outside the enclosure to connect the earth signal.

The device can also be integrated to the equalization through the pipeline as long the earth connection is conform to regulations.

6.5 Service kit

No connection of service-kit or any other devices are permitted if the atmosphere is considered to be explosive.

Alternatively device settings can be done through the Modbus interface from a remote location (non-explosive area) if the cable is installed.

Please contact our service for available devices and software.


6.6 Fuse

The power supply for the flow transmitter needs to have a fuse with following specification:


Voltage 16 to 30 DC, fuse 0.5 A slow blow (according to IEC 127)

6.7 Back cover / security seal

The Back cover of the sensor is secured with a screw to avoid the opening of the cover by unauthorized persons. Please ensure that the security screw is tighten up after finishing the installation!

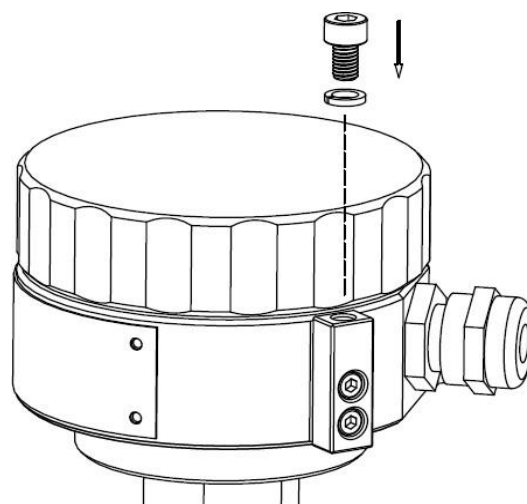

Security screw at
back cover

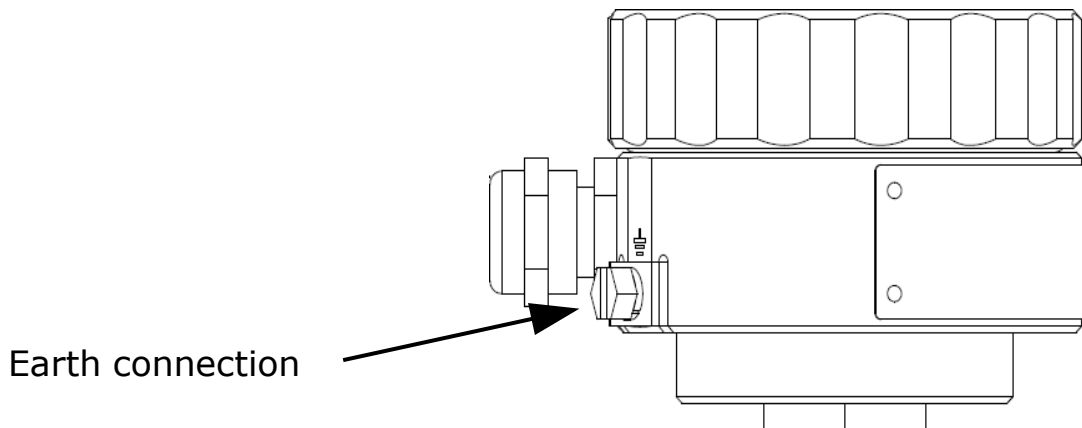

6.8 Used standards

EN 60079-0:2009

EN 60079-1:2007

6.9 Determination of the installation point

In order to maintain the accuracy stated in the technical data, the sensor must be installed correctly. The air must flow on to the sensor tip, otherwise it will lead to wrong measurement values. For further instructions, please read the next chapter carefully.

Please consider that enough space exists at your site for a adequate installation as described in this manual.



ATTENTION!

Wrong measurement is possible, if the sensor is not installed correctly.

- **It is strongly recommend not to install S 230/231 permanently in wet environment as it exists usually right after a compressor outlet.**


6.10 Installation Requirements

The flowing air or gas has to pass the sensor tip for a proper measurement. This can be realized with a measurement chamber. For a installation without measuring chamber you need to concern the installation depth which is described in the next chapter.

6.11 Sensor installation to compressed air / gas

The following steps explain the procedure of an appropriate installation.

Installation of the sensor with measurement chamber

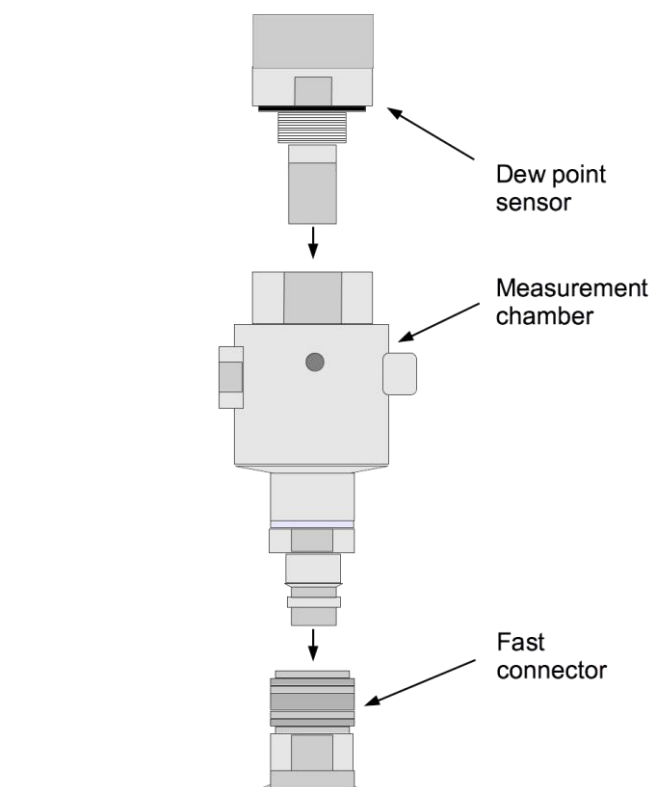


1. connect the sensor with the measurement chamber.
2. Connect the sensor and the measurement chamber with the fast connector.

Attention:


For explosive gas application, installation with measurement chamber is not allowed!

Installation of the sensor without measurement chamber

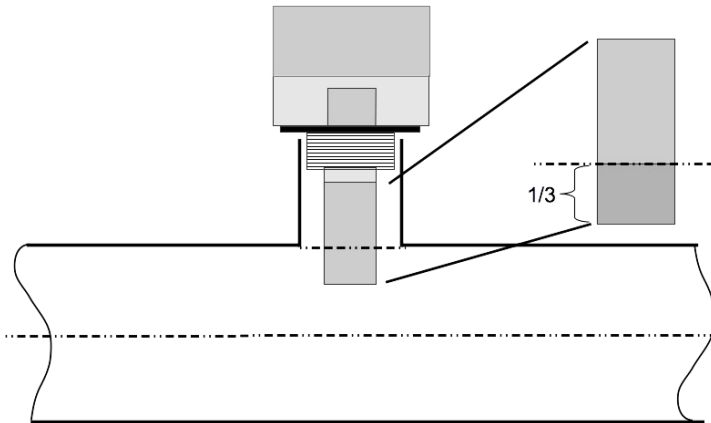

- Install the sensor only if the system is not pressurized.
- Not less than 1/3 of the sensor tip should be inside of the pipe. For this please check the size of the nozzle.
- The inner thread has to be G 1/2".

Remarks

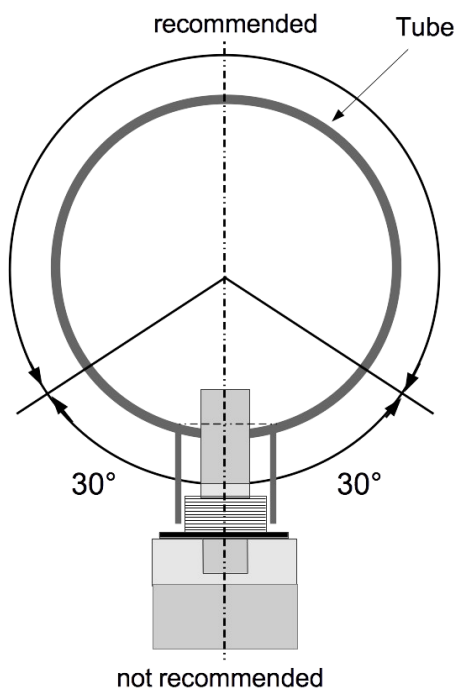



Please install the sensor only in the recommended area as you can see in the picture. A upside down installation is not permitted. Please consider that the distance to the vertical level must be $>30^\circ$.

Removal of the sensor

To remove the sensor unscrew the sensor from the measurement chamber or from the nozzle. Please observe that the system is not pressurized when the sensor is removed.

6.12 Electrical connection

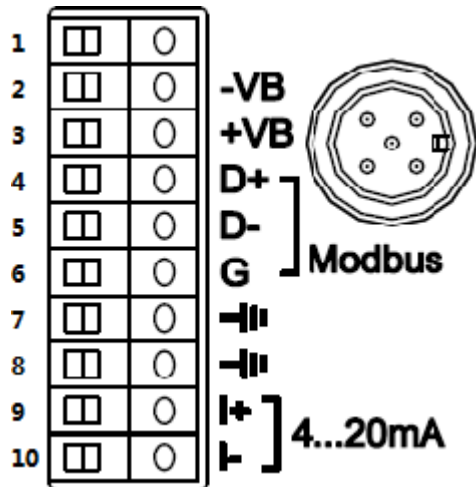

-VB: negative power supply
+VB: positive power supply
D+: Modbus D+
D-: Modbus D-
G: Modbus Ground
 Earth, shielding connection
I+: 4 ... 20 mA positive connection
I-: 4 ... 20 mA negative connection

7. Signal outputs

7.1 Analogue output

The sensor has an analogue output range of 4 ... 20 mA. The signal is isolated from the power supply. This output is scaled to:

	S 230	S 231
4 mA	-100 °Ctd	-50 °Ctd
20 mA	+20 °Ctd	+20 °Ctd

Ex factory the dew point signal is routed to the analogue output. However the user can choose other moisture signals to be used instead. Please contact our service for assistance.

7.2 Modbus output

Mode : RTU
Baud rate : 19200
Device address : 1
Framing / parity / stop bit : 8, N, 1
Response delay : 0 ms
Inter-frame spacing : 7 char

Remarks

- Modbus communication settings can be changed by the service software.

Holding register	Channel description	Format
1	Temperature	FLOAT
3	Relative humidity	FLOAT
5	Reserved	FLOAT
7	Pressure dew point	FLOAT
9	Alternative measurement unit	FLOAT
41	Temperature unit	INTEGER
43	Relative humidity unit	INTEGER
45	Reserved	INTEGER
47	Pressure dew point unit	INTEGER
49	Alternative humidity unit	INTEGER
51	Status	INTEGER

Remarks:

- Data length is always 4 Byte
- FLOAT representation according to IEEE 754
- The physical units are coded according to the table below
- Status definition:
 - Bit2 DP over range
 - Bit3 Temperature over range
 - Bit6 Calibration overdue
 - Bit7 EEPROM broken
 - Bit8 DP sensor broken
 - Bit10 QCM sensor broken
 - Bit11 NTC broken

Unit Table:

Temperature in °C	1
Temperature in °F	2
Relative humidity in %	3
Dew point in °C	4
Dew point in °F	5
Mixing ratio in mg/kg	6
Absolute humidity in mg/m ³	7
Mixing ration in g/kg	8

Absolute humidity in g/m ³	9
Parts per million in ppm _v	30
Atmospheric dew point in °C	31
Atmospheric dew point in °F	32

8. Optional extra accessories


8.1 Measuring chambers

There are different types of measuring chambers for example Measuring chamber with fast connector, by-pass-by chamber with in and out connection, measuring chamber for dryer installation or high pressure chamber. For more information please contact your retailer or the manufacturer.

8.2 Service kit

The service kit is used to connect the sensor with the PC. Sensor parameters such as analogue output scaling, alarm values, units etc. can be easily changed by using the service kit.

The diagram below shows the connection when using the optional service kit. In case the sensor is connected with power supply and Modbus to a master device, **please remove the Modbus connection** first before connecting the service kit.

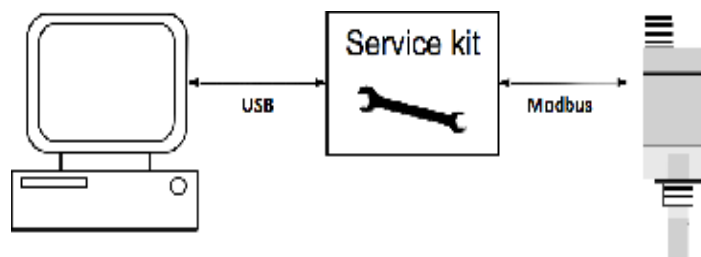

9. Calibration

The sensor is calibrated ex work. The exact calibration date is printed on the certificate which is supplied together with the sensor. The accuracy of the sensor is regulated by the on site conditions, parameters like oil, high humidity or other impurities can affect the calibration and furthermore the accuracy. However we recommend to calibrate the instrument at least once per year. The calibration is excluded from the instruments warranty. For this please contact the manufacturer.

10. Maintenance

Please observe from time to time the sinter cap. If it appears to be dirty, it is recommended to replace it for this please contact the manufacturer.



ATTENTION!

A dirty/wet/contaminated sinter cap or sensor tip may lead to a longer response time and to wrong measurements.

11. Disposal or waste

Electronic devices are recyclable material and do not belong in the household waste.

The sensor, the accessories and its packings must be disposed according to your local statutory requirements. The dispose can also be carried by the manufacturer of the product, for this please contact the manufacturer.

12. Warranty

SUTO provides a warranty for this product of 24 months covering the material and workmanship under the stated operating conditions from the date of delivery. Please report any findings immediately and within the warranty time. If faults occurring during the warranty time SUTO will repair or replace the defective unit, without charge for labour and material costs but there is a charge for other service such as transport and packing costs.

Excluded from this warranty is:

- Damage caused by:



- Improper use and non-adherence to the instruction manual.
- Use of unsuitable accessories.
- External influences (e.g. damage caused by vibration, damage during transportation, excess heat or moisture).

The warranty is cancelled:

- If the user opens the measurement instrument without a direct request written in this instruction manual.
- If repairs or modifications are undertaken by third parties or unauthorised persons.
- If the serial number has been changed, damaged or removed.

Other claims, especially those for damage occurring outside the instrument are not included unless responsibility is legally binding.

Warranty repairs do not extend th



info@aservicios.mx



+52 (444) 822 7692



www.airtec-servicios.com



